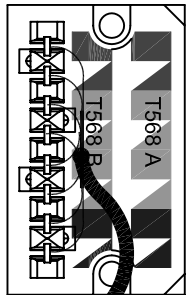| TITLE: CLARITY SERIES II INSTRUCTION SHEET			
INSTRUCTION SHEET #: 71601234	REVISION:	DWN.BY: Dbogue	
DATE: 04/15/02			SHEET NO.: 1 OF 2

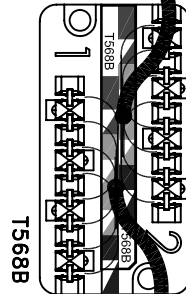Choose T568A or T568B wiring and follow instructions below.

Clarity 1 port uses universal wiring label — 1 Port

Follow T568A or T568B wiring format

Pointed lacing towers

T568 A

T568 B

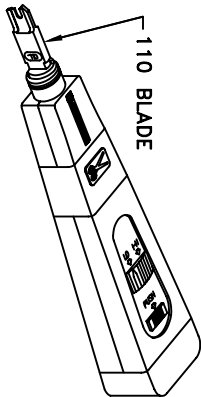**Clarity 2 port is supplied with T568B label attached** — 2 Port
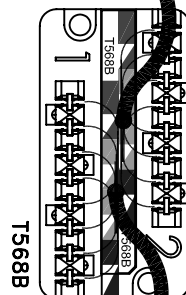
Attach supplied T568A label if that wiring is required

T568B

T568A
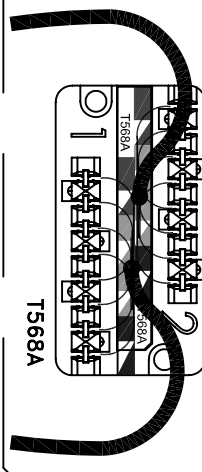
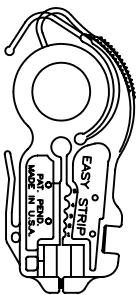## TERMINATION INSTRUCTIONS

1. Bring cable through plate or box openings. (ref other side of this instruction).
2. Remove 2" of jacket, center jacketed cable in middle of 110D-4.
3. Maintain pair twist as close as possible to point of termination, untwisting not to exceed 1/2" (13mm). (Use pointed towers to separate conductors of pairs).
4. Wire per color code instructions. Punch down with trimming blade and apply caps.

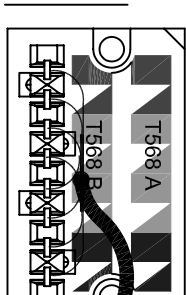Note: The minimum required depth of the wall outlet is 1.50".

110 BLADE

RECOMMENDED TERMINATION TOOL
OR-60300005 (TOOL & BLADE)
OR-60300006 (BLADE ONLY)

RECOMMENDED STRIPPER TOOL
OR-60300032 (TOOL)

EASY STRIP MADE IN U.S.A.

CAD: 71601234I

ORTRONICS®
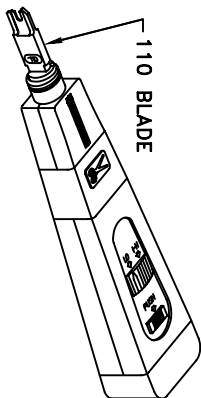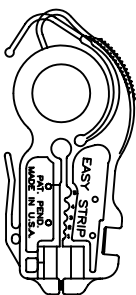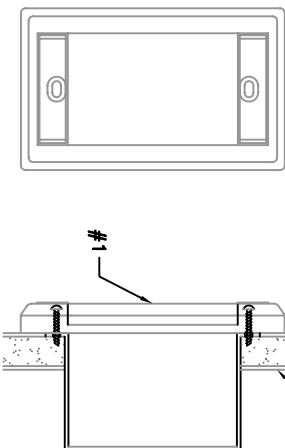125 EUGENE O'NEILL DRIVE
NEW LONDON, CT 06320
TEL: 860-445-3800
FAX: 860-405-2990

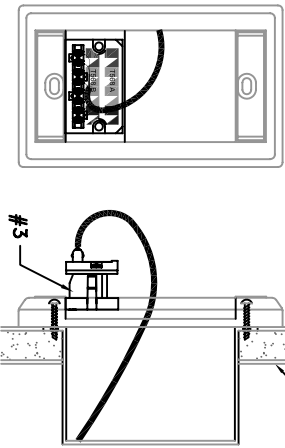| TITLE: CLARITY SERIES II INSTRUCTION SHEET			
DATE: 04/15/02	INSTRUCTION SHEET #: 71601234	REVISION:	DWN.BY: Dbogue
		SHEET NO. 2 OF 2	

INSTALLATION INSTRUCTIONS
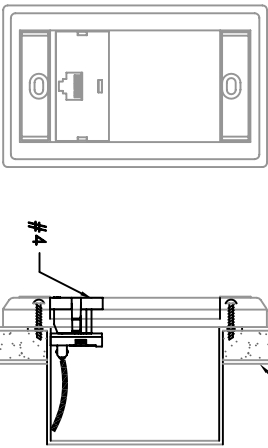
#1 Mount faceplate or housing to wall.

#2 Bring all cables through plate or box openings.
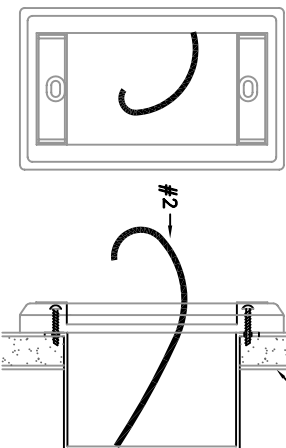
#3 Support module in plate or on flat surface, terminate all cables. (ref. other side of this instruction).

#4 Reverse modules and snap into faceplates or boxes.

Note: The use of a service loop above the ceiling or in a wall should be used to minimize excess cable storage in the outlet box.
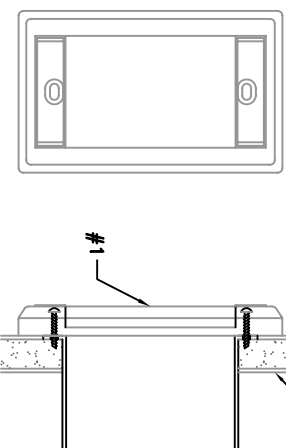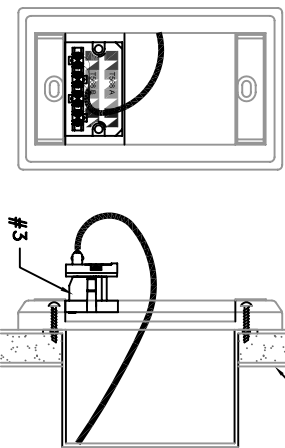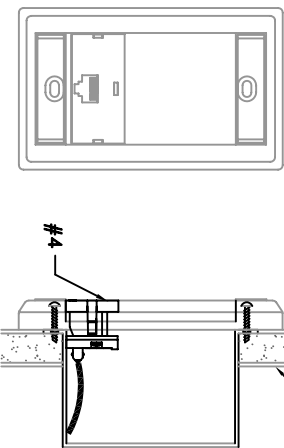
CAD: 71601234Z